

FIG. 1

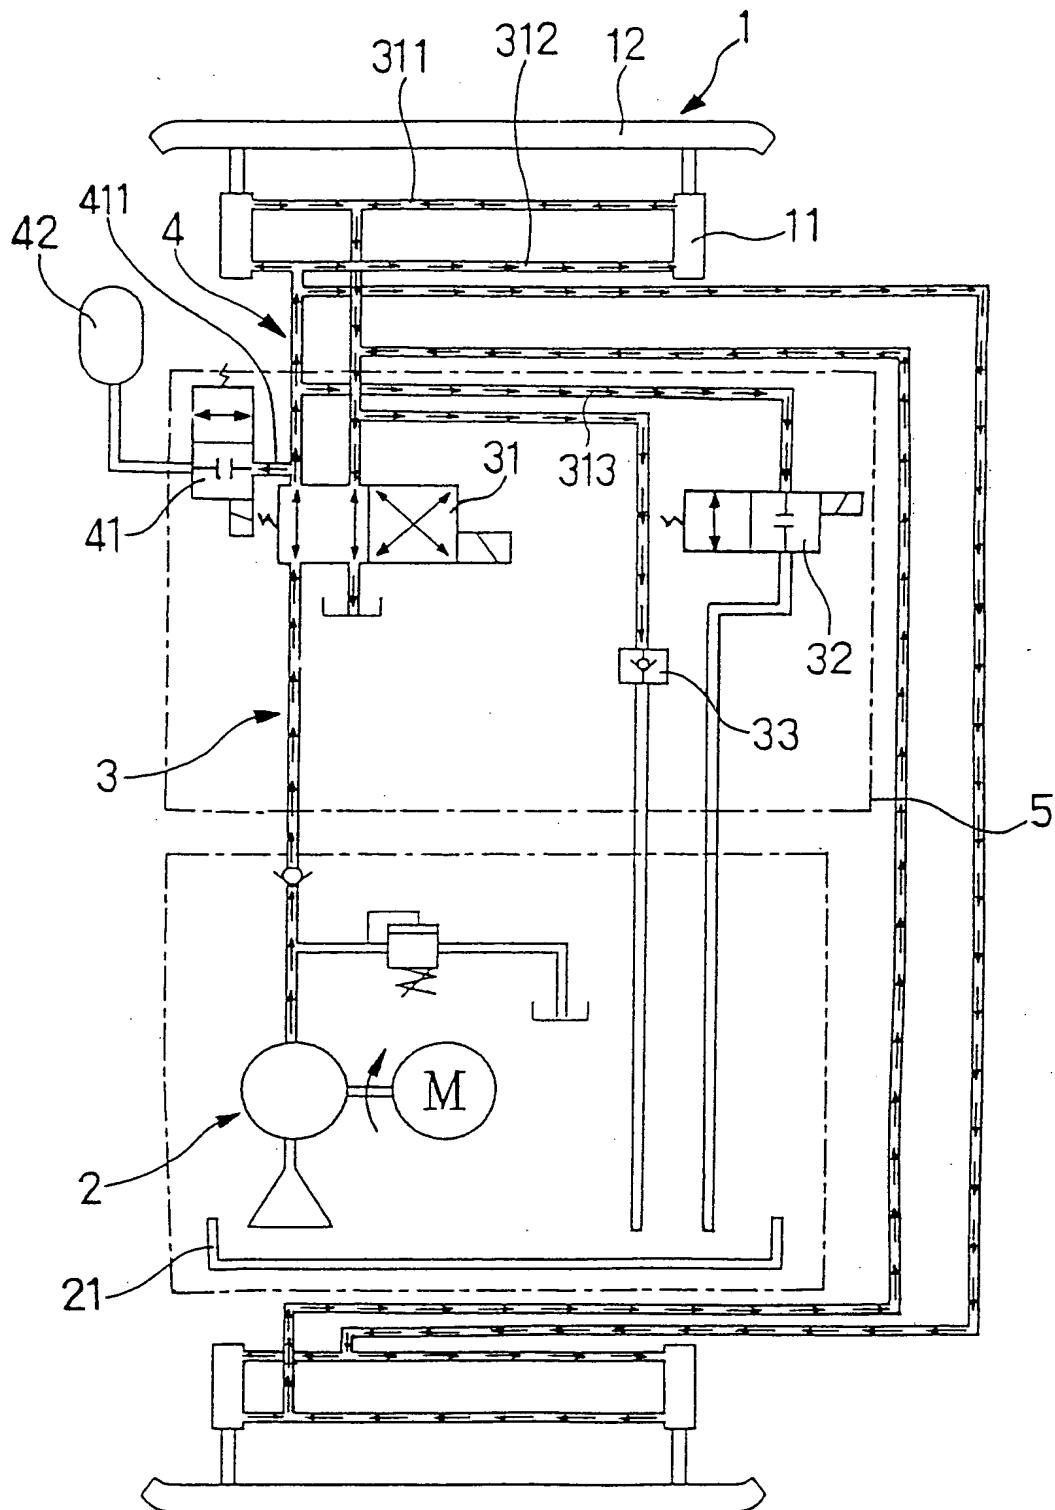


FIG. 2

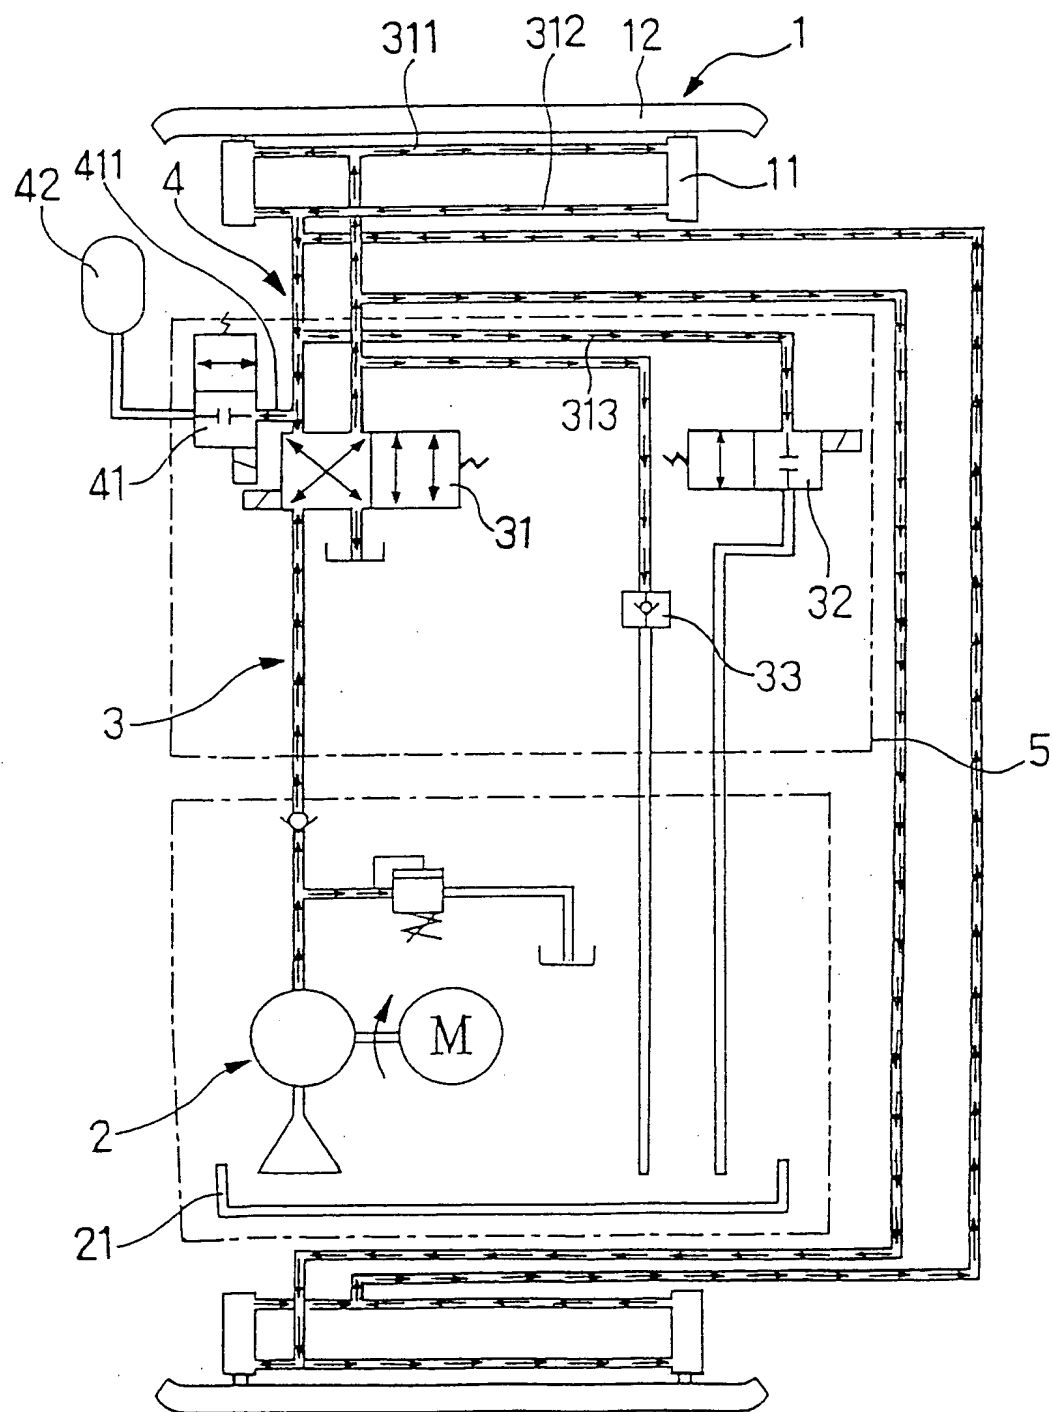


FIG. 3

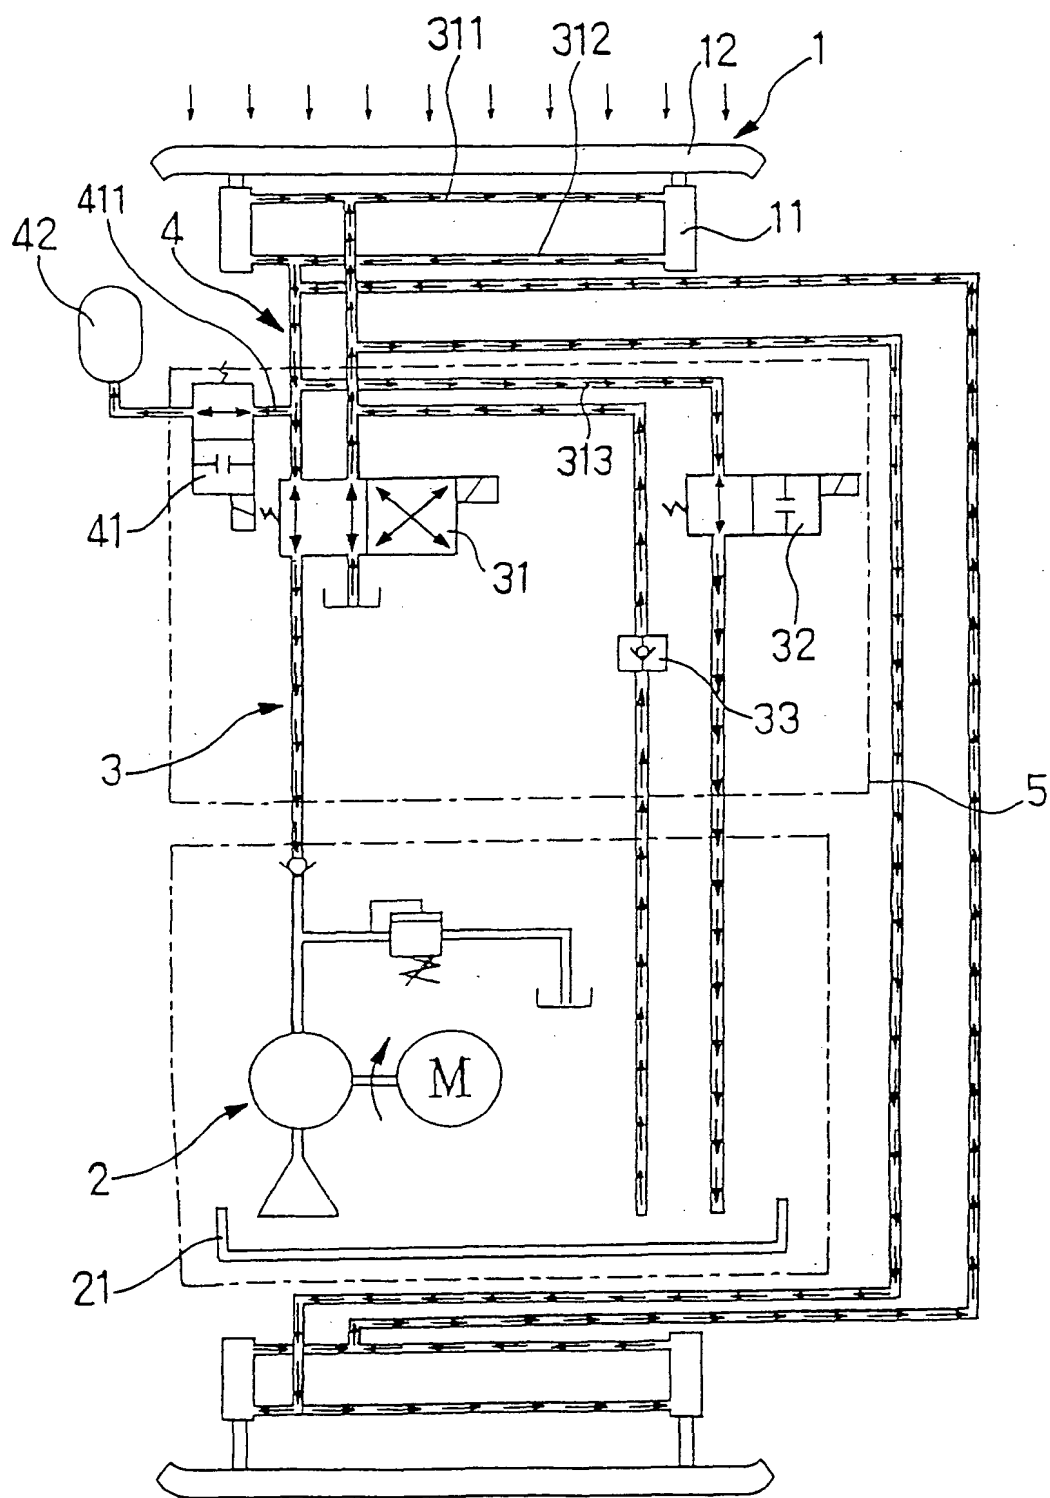


FIG. 4

* DRIVER SIDE
x PASSENGER SIDE

REPORT NO: 88-VS2880033
PAGE 6 OF 8

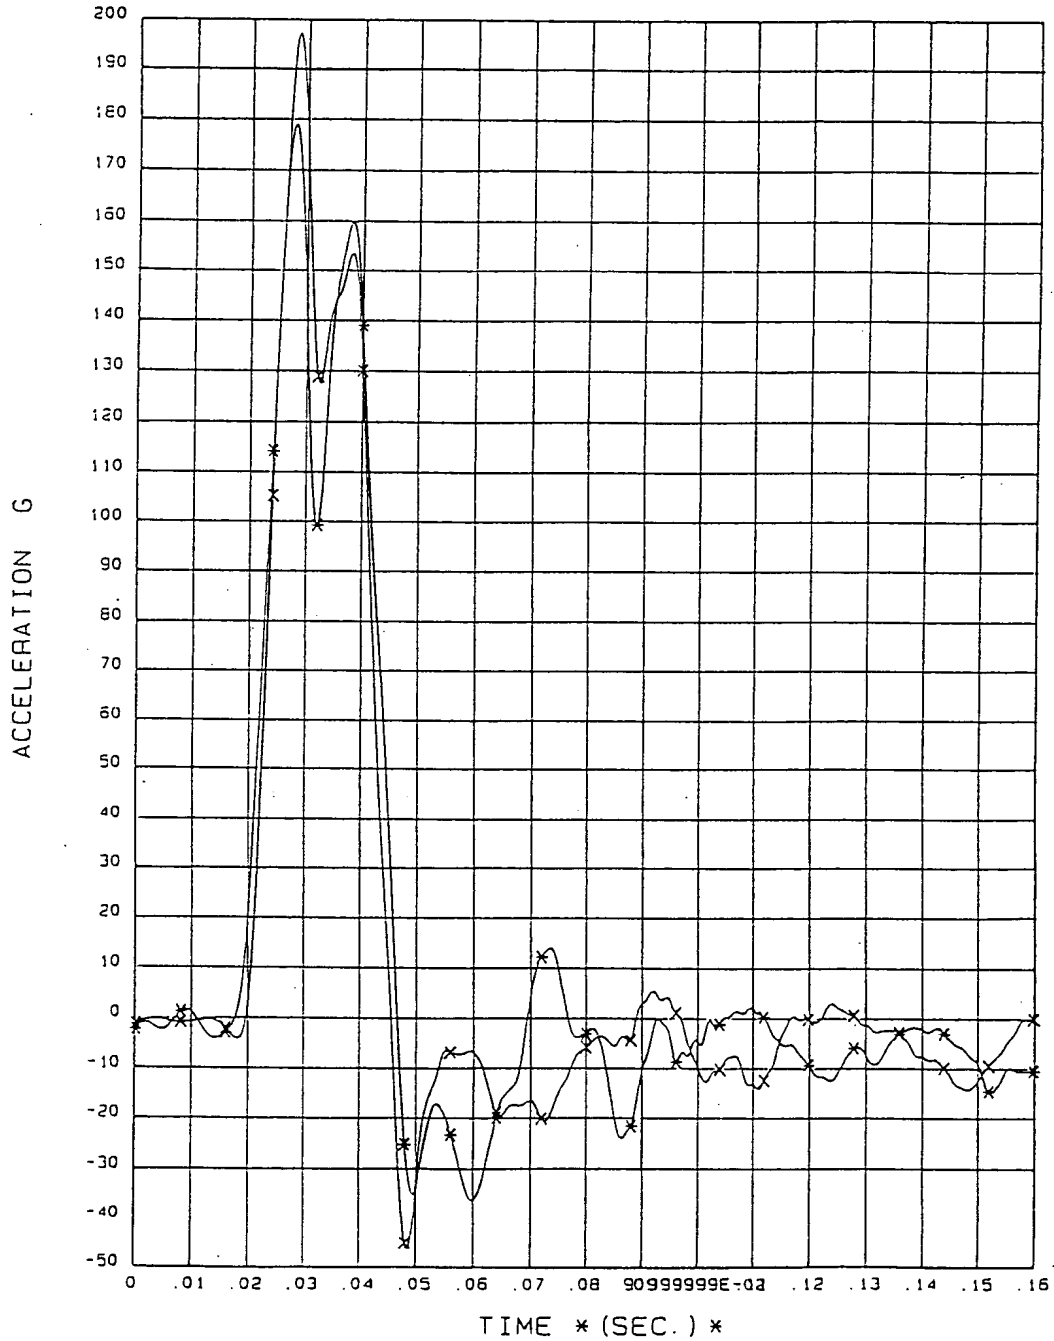


FIG. 5A

* DRIVER SIDE
x PASSENGER SIDE

REPORT NO.: 88-VS2880033
PAGE 3 OF 8

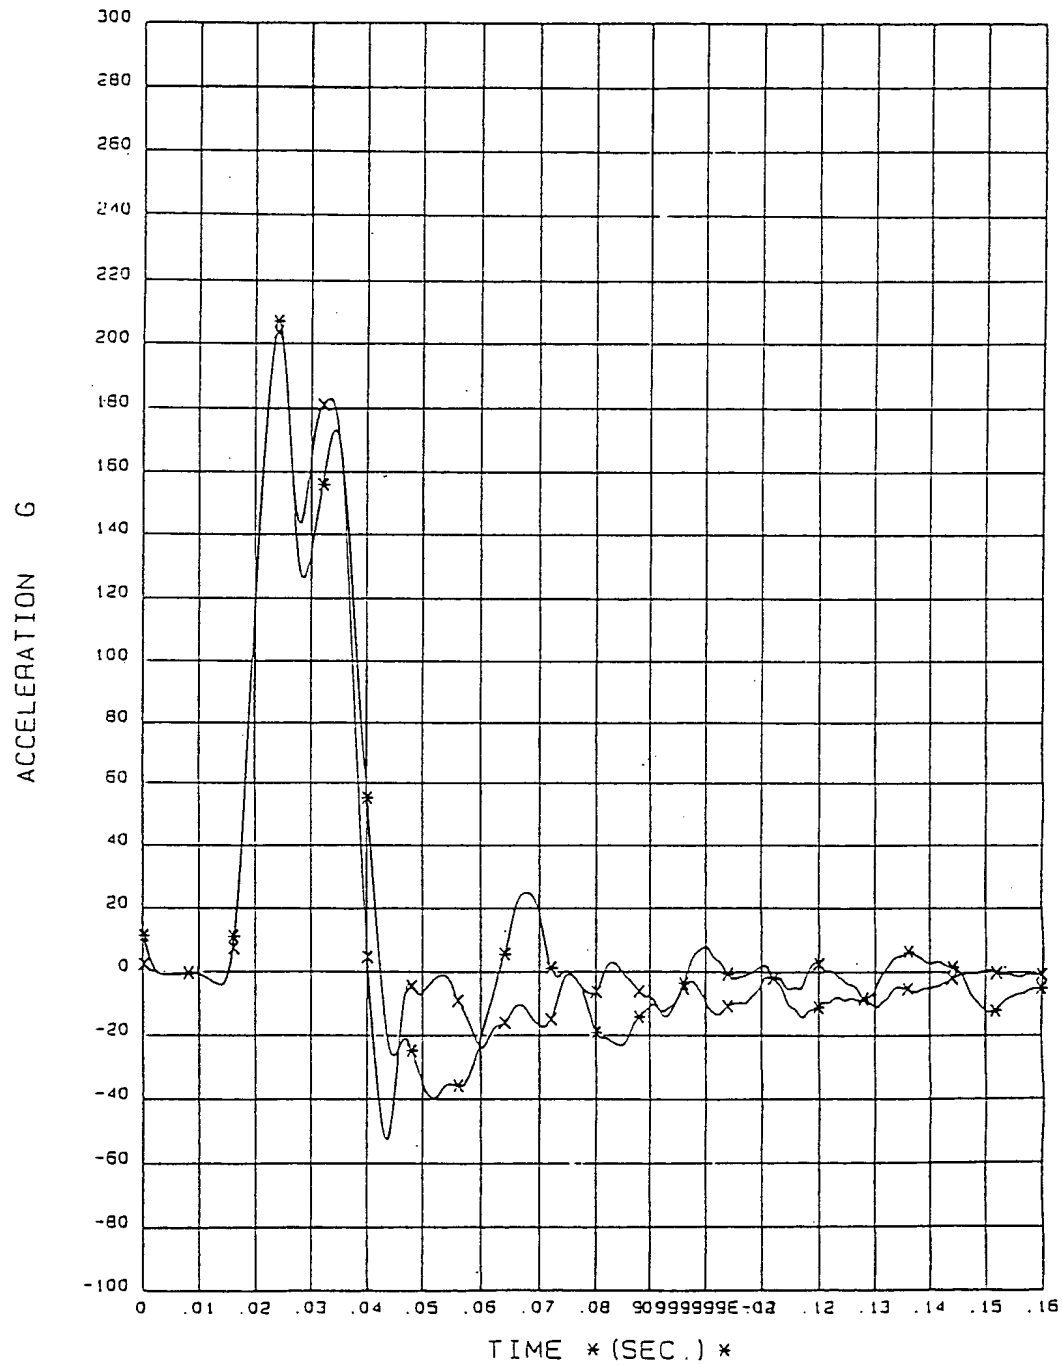


FIG. 5B

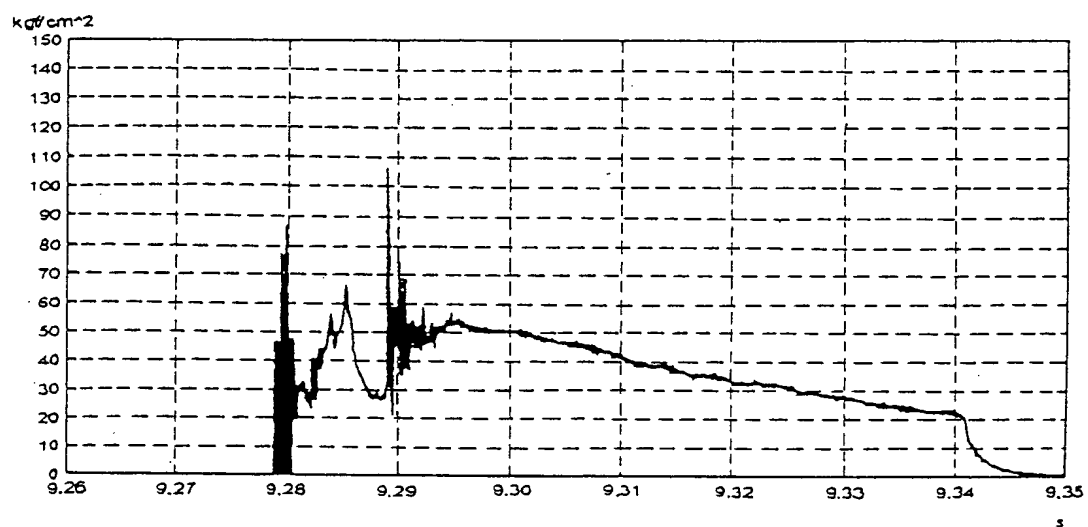


FIG. 5C

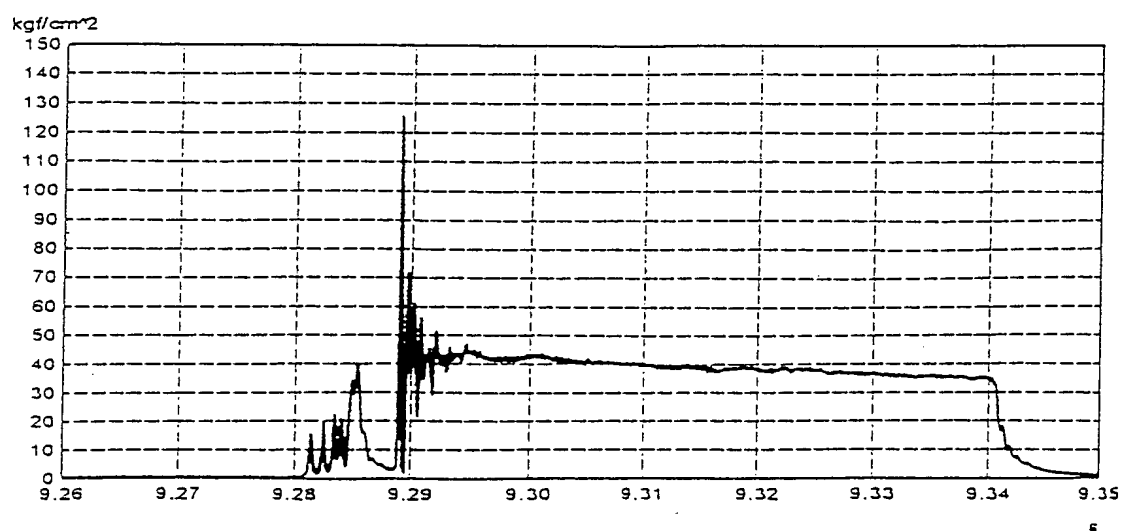


FIG. 5D

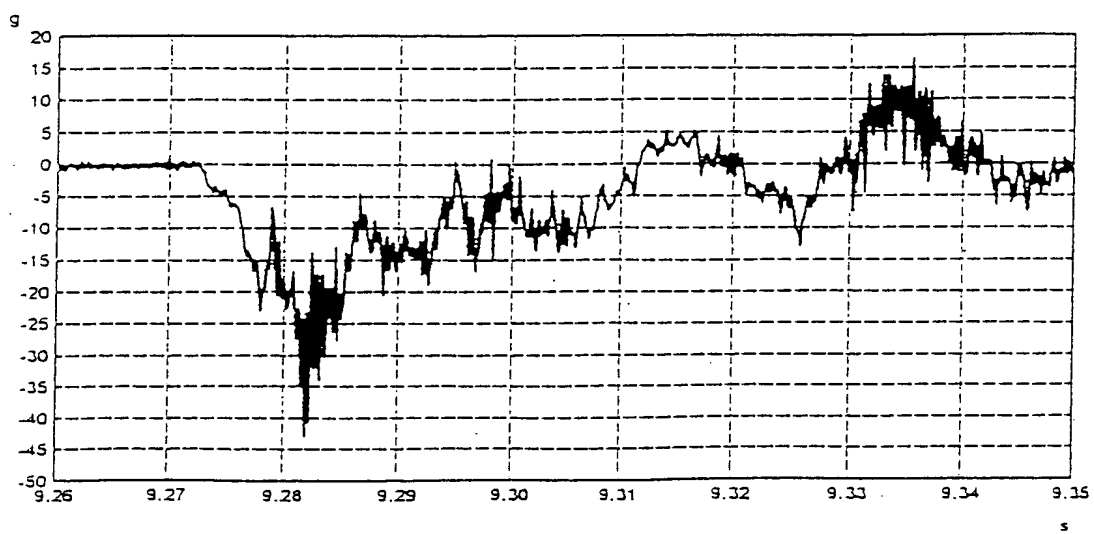


FIG. 5E

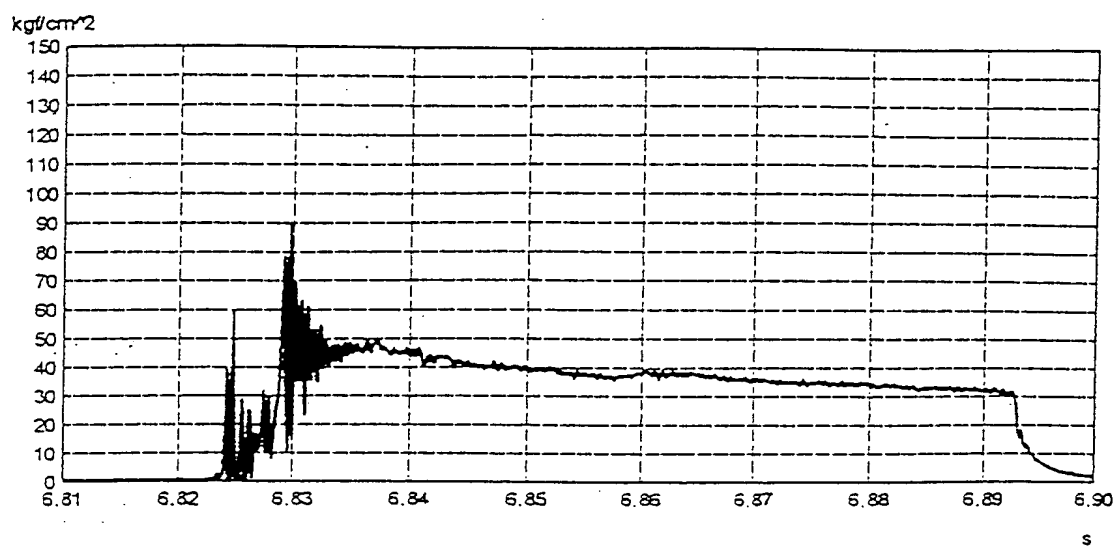


FIG. 5F

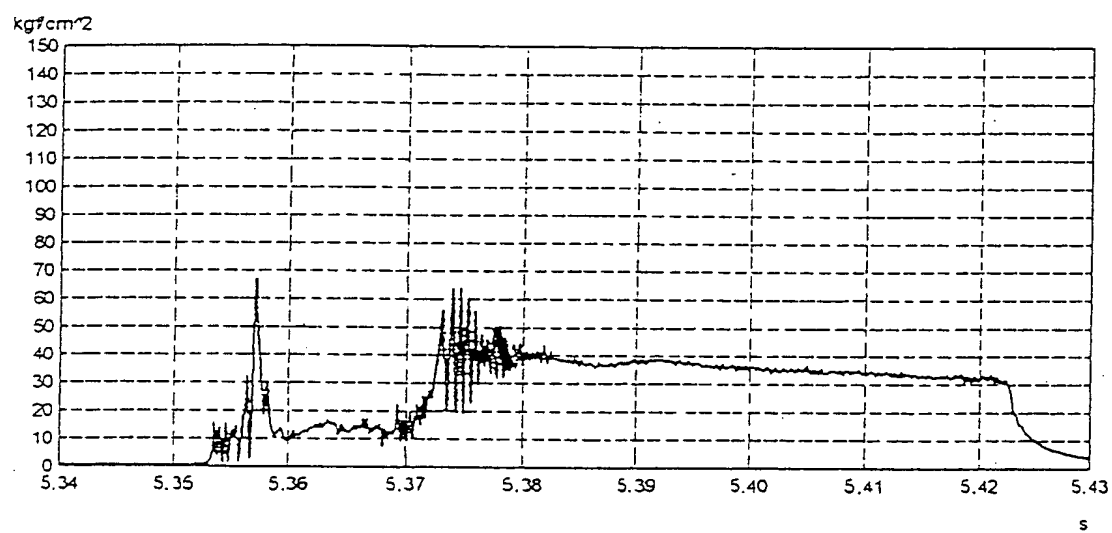


FIG. 5G

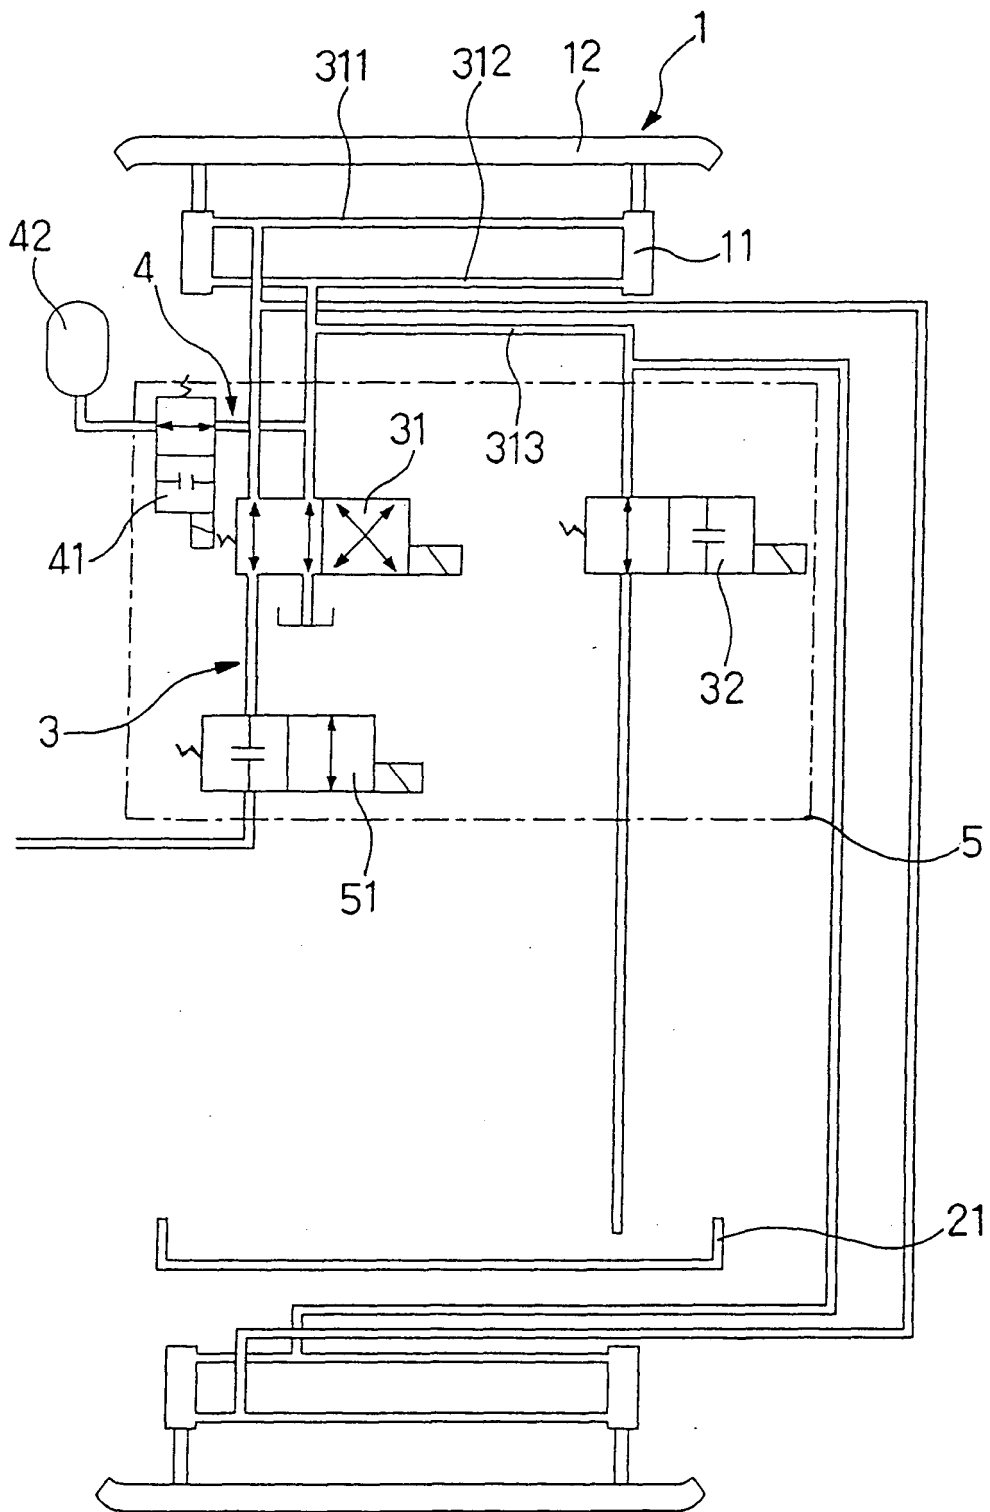


FIG. 6

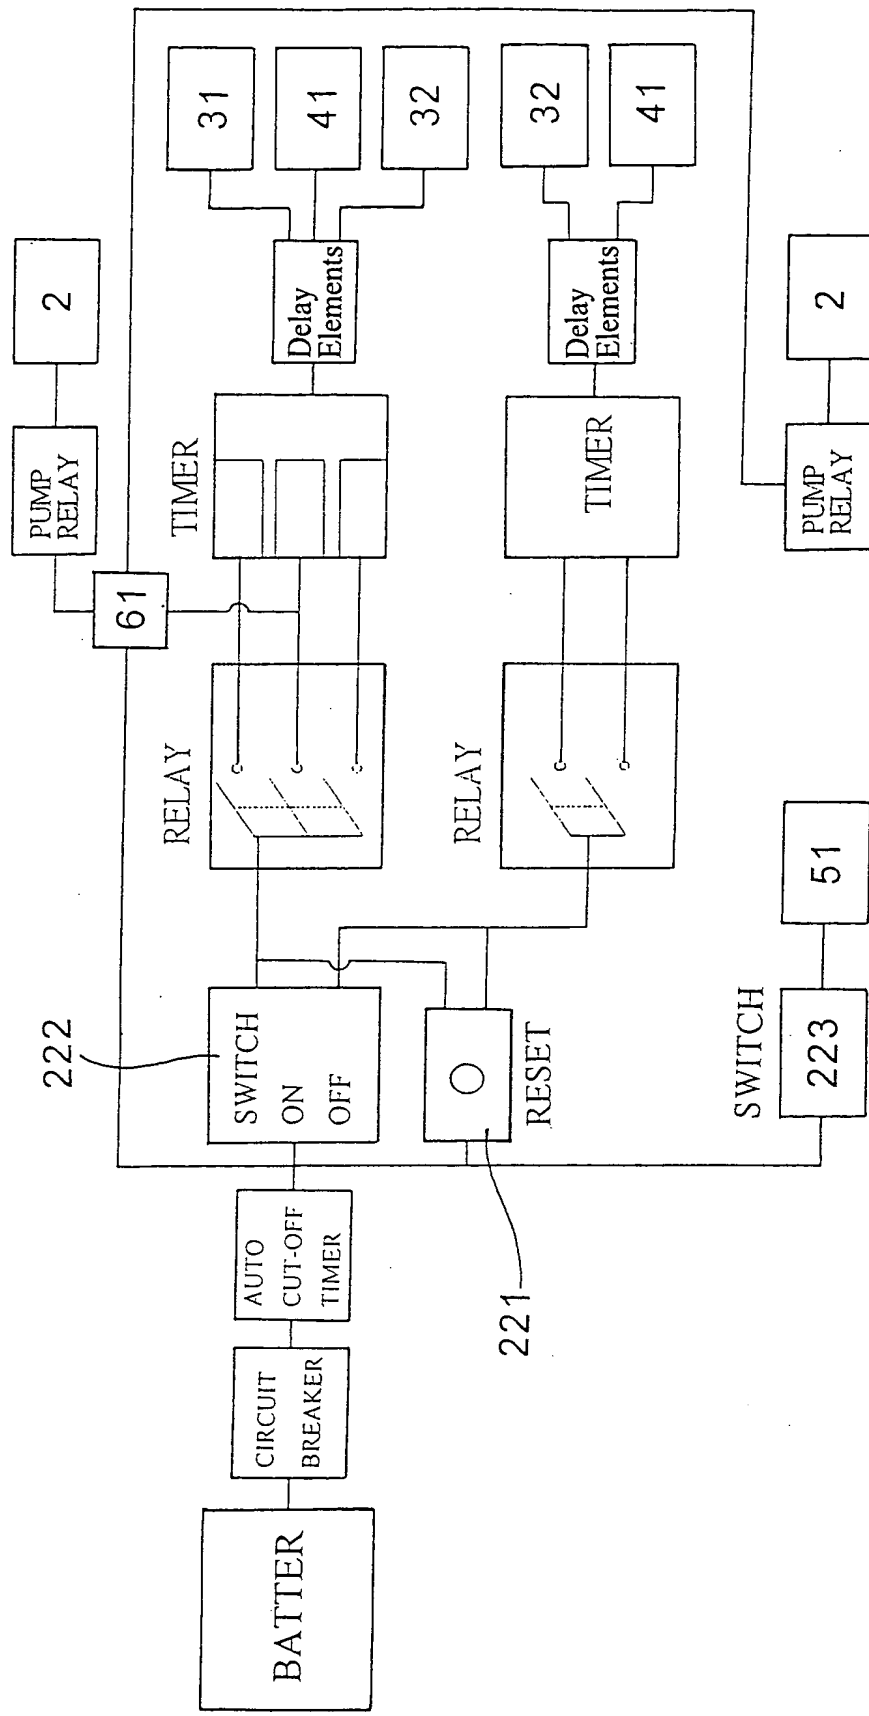


FIG. 7A

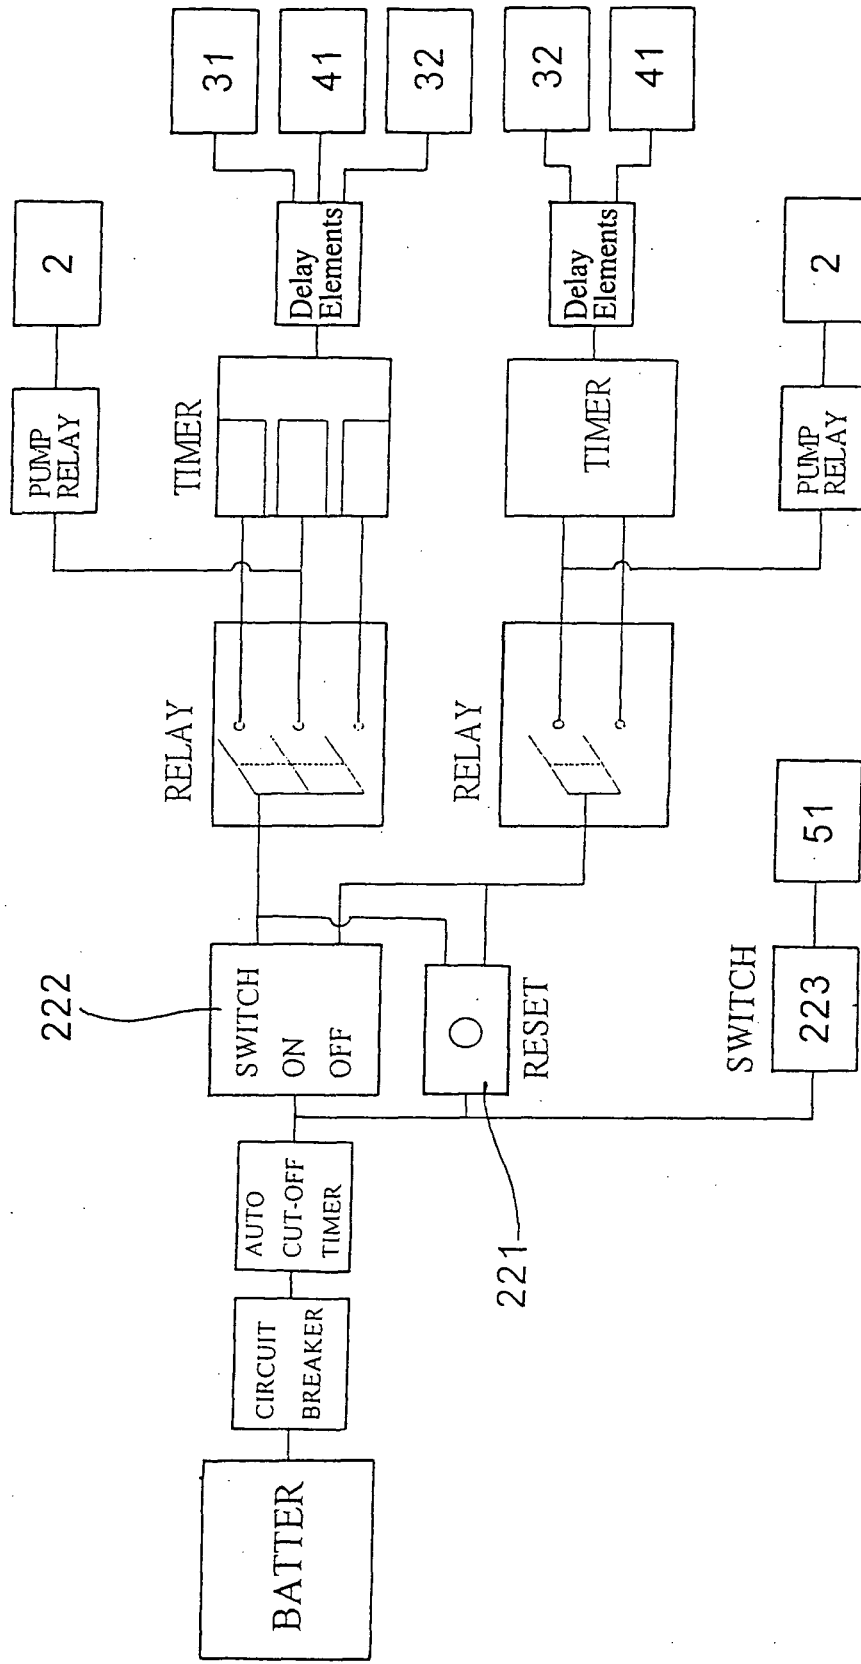


FIG. 7B

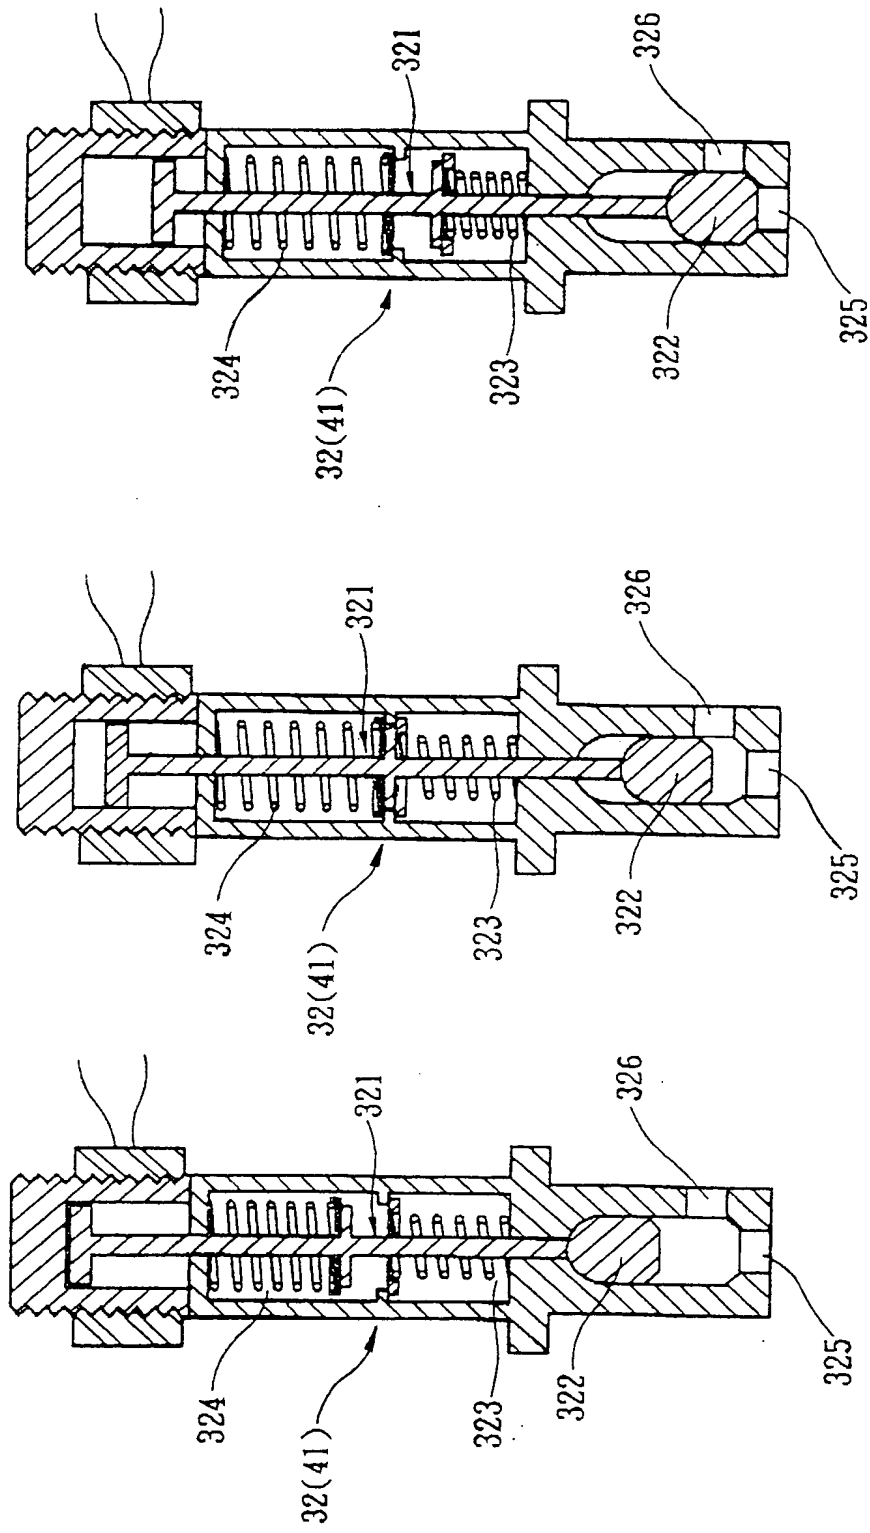


FIG. 8C

FIG. 8B

FIG. 8A